

Acquire Fire Protection, Inc.17012 Kinsman Road
Middlefield, Ohio 44062**Fire Suppression Systems****Service History**

Order # 11418

JOB LOCATIONKFC
29050 Lake Shore Blvd,
(440) 943-4242
Willowick OH 44095
Service Date: 11/5/2015P1: (440)943-4242
P2: (440)223-5754
F:**CLIENT**KFC
29050 Lake Shore Blvd,
Willowick OH 44095**CONTACT**

Mike

TECHNICIAN

JAL

Fire Suppression System

Num: 1

Type: Wet Chemical Extinguishing System

Manufacturer: Ansul

Model: R-102 3 Gallon

Location: Fry Hood

Install Date: 2007

Last Service: 11/5/2015

Duct Size: 10" X 10"

Nozzle Type: 1W

Plenum Size: 18" X 36"

Nozzle Type: 1N

Serial #: S-183848

Bar Code: AQ0005827

Timestamp: 11/5/2015 8:31:08 AM

Tests/Inspections/Services

Description	Last	Due
Hydro Test	2007	<input type="checkbox"/>
Monthly		<input type="checkbox"/>
Recharge		<input type="checkbox"/>
Semi-Annual	11/2015	<input checked="" type="checkbox"/>
Flush Piping		<input type="checkbox"/>
New		<input type="checkbox"/>

Cylinders

Num	Size	Type	Mfg Date	Hydro	6 Year	S/N	Bar Code	Timestamp
1	3 Gal	Extinguishing Agent	2007			N/A		
2	42 3/8	Cartridge	2007			N/A		

Replacement Parts

Qty	Description	Part No.	Replaced
2	Fuse Links 450°F K Link	450K-11	11/5/2015
4	Ansul Nozzle Cap	AS77695	4/2015

Appliances (Left to Right)

Num	Description	Size	Nozzle(s)
-----	-------------	------	-----------

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems

Service History

Order # 11418

JOB LOCATION

KFC
29050 Lake Shore Blvd,
(440) 943-4242
Willowick OH 44095

CLIENT

P1: (440)943-4242
P2: (440)223-5754
F:

KFC
29050 Lake Shore Blvd,
Willowick OH 44095

Num	Description	Size	Nozzle(s)
1	Fryer - Gas	15 "	245, 245

INSPECTION

I. Fire Suppression Systems

	OK	FAIL	NA
1. Hood and appliances properly protected?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
2. Was nozzle/appliance alignment correct upon arrival?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
If not was the alignemnt corrected during inspection?			
3. System cylinder gauge in operable range?	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
4. Cylinder weight or liquid level OK?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
5. Fusible links replaced?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
6. Actuation cartridge weight or gauge in operable range?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
/* Stamped weight 42 5/8 oz, Actual weight 42 5/8 oz */			
7. Complete fuel shut-down operational?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
8. Remote pull station accessible and operational?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
9. All components clean and free of grease?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
10. Nozzle caps cleaned or replaced?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
11. System meets manufacturer installation instructions?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
12. System conduit and piping securely mounted?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
13. Does system meet UL 300 standard?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
14. Employees trained in the proper operation of the system?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
15. Audible and/or visual alarms functional?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
16. System reset and placed back in service?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
17. System connected to central station?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
18. Class K extinguisher present and functional?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
19. Do hood and duct comply with NFPA #96?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
20. Company State of Ohio Certification # 53-28-1034	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
21. State of Ohio Certification Jon LeRoy 54-18-1535	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
22. State of Ohio Certification Randolph N Kaser 54-18-0381	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
23. Complete Hydrostatic Pressure Test Current	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
24. Complete 6 Year Maintenance Current	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>

I state that the information on this form is correct at the time and place of my inspection. And that all equipment tested at this time was left in operational condition upon completion of this inspection except as noted above.

Acquire Fire Protection, Inc. / Fire Loss Control, Inc.

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems

Service History

Order # 11418

JOB LOCATION

KFC
29050 Lake Shore Blvd,
(440) 943-4242
Willowick OH 44095

P1: (440)943-4242
P2: (440)223-5754
F:

CLIENT

KFC
29050 Lake Shore Blvd,
Willowick OH 44095

Technician

X 

Jonathan LeRoy

11/5/2015

Customer Signature

X _____

Fire Inspector

X 

11/5/2015

*** End Report: 1 ***

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.17012 Kinsman Road
Middlefield, Ohio 44062**Fire Suppression Systems****Service History**

Order # 11418

JOB LOCATIONKFC
29050 Lake Shore Blvd,
(440) 943-4242
Willowick OH 44095
Service Date: 11/5/2015P1: (440)943-4242
P2: (440)223-5754
F:**CLIENT**KFC
29050 Lake Shore Blvd,
Willowick OH 44095**CONTACT**

Mike

TECHNICIAN

JAL

Fire Suppression SystemNum: 2
Type: Wet Chemical Extinguishing System
Manufacturer: Ansul
Model: R-102 7.5 Gallon
Location: Large Fry Hood
Install Date: 2007
Last Service: 11/5/2015Serial #: S-183840
Bar Code: AQ0005831
Timestamp:**Tests/Inspections/Services**

Description	Last	Due
Hydro Test	2007	<input type="checkbox"/>
Monthly		<input type="checkbox"/>
Recharge		<input type="checkbox"/>
Semi-Annual	11/2015	<input checked="" type="checkbox"/>
Flush Piping		<input type="checkbox"/>
New		<input type="checkbox"/>

Cylinders

Num	Size	Type	Mfg Date	Hydro	6 Year	S/N	Bar Code	Timestamp
1	3 Gal	Extinguishing Agent	2007			N/A	AQ0005828	
2	3 Gal	Extinguishing Agent	2007			N/A	AQ0005829	
3	1.5 Gal	Extinguishing Agent	2007			N/A	AQ0005830	
4	59 3/8	Cartridge	2007					
5	42 1/2	Cartridge	2007					

Replacement Parts

Qty	Description	Part No.	Replaced
9	Ansul Nozzle Cap	AS77695	11/2015
6	Fuse Links 450°F K Link	450K-11	11/2015

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems

Service History

Order # 11418

JOB LOCATION

KFC
29050 Lake Shore Blvd,
(440) 943-4242
Willowick OH 44095

CLIENT

P1: (440)943-4242
P2: (440)223-5754
F:

KFC
29050 Lake Shore Blvd,
Willowick OH 44095

Qty	Description	Part No.	Replaced
-----	-------------	----------	----------

INSPECTION

I. Fire Suppression Systems

	OK	FAIL	NA
1. Hood and appliances properly protected?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
2. Was nozzle/appliance alignment correct upon arrival?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
If not was the alignment corrected during inspection?			
3. System cylinder gauge in operable range?	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
4. Cylinder weight or liquid level OK?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
5. Fusible links replaced?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
6. Actuation cartridge weight or gauge in operable range?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
/* Stamped weight 42 3/4, 59 3/8 oz, Actual weight 42 3/4, 59 3/8 oz */			
7. Complete fuel shut-down operational?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
8. Remote pull station accessible and operational?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
9. All components clean and free of grease?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
10. Nozzle caps cleaned or replaced?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
11. System meets manufacturer installation instructions?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
12. System conduit and piping securely mounted?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
13. Does system meet UL 300 standard?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
14. Employees trained in the proper operation of the system?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
15. Audible and/or visual alarms functional?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
16. System reset and placed back in service?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
17. System connected to central station?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
18. Class K extinguisher present and functional?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
19. Do hood and duct comply with NFPA #96?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
20. Company State of Ohio Certification # 53-28-1034	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
21. State of Ohio Certification Jon LeRoy 54-18-1535	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
22. State of Ohio Certification Randolph N Kaser 54-18-0381	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>
23. Complete Hydrostatic Pressure Test Current	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
24. Complete 6 Year Maintenance Current	<input type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>

I state that the information on this form is correct at the time and place of my inspection. And that all equipment tested at this time was left in operational condition upon completion of this inspection except as noted above.

Acquire Fire Protection, Inc. / Fire Loss Control, Inc.

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems

Service History

Order # 11418

JOB LOCATION

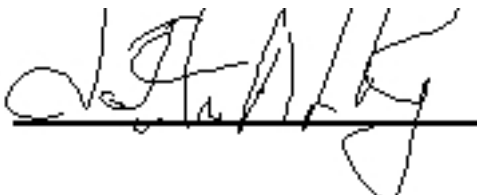
KFC
29050 Lake Shore Blvd,
(440) 943-4242
Willowick OH 44095

P1: (440)943-4242
P2: (440)223-5754
F:

CLIENT

KFC
29050 Lake Shore Blvd,
Willowick OH 44095

Technician

X 

Jonathan LeRoy

11/5/2015

Customer Signature

X _____

Fire Inspector

X 

11/5/2015

*** End Report: 2 ***

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS