

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems**Service History**

Order # 11399

JOB LOCATION

Freshlys
34500 Euclid Avenue
216-773-0928
Willoughby OH 44094
Service Date: 12/4/2015

P1: (216)773-0928
P2:
F:

CLIENT

Freshlys
34500 Euclid Avenue
Willoughby OH 44094

CONTACT

Jim Sarris

TECHNICIAN

JAL

Fire Suppression System

Num: 1

Type: Wet Chemical Extinguishing System

Manufacturer: Ansul

Model: R-102 3 Gallon

Location: kitchen

Install Date: 2001

Last Service: 11/10/2015

Duct Size: 12 X 18

Nozzle Type: 2W

Plenum Size: 20" X 12Ft-6"

Nozzle Type: 2 - 1N

Serial #: S 007941

Bar Code: AQ0003416

Timestamp: 11/10/2015 9:04:16 AM

Tests/Inspections/Services

Description	Last	Due
Hydro Test	2012	☐
Monthly		☐
Recharge		☐
Semi-Annual	11/2015	☒
Flush Piping		☐
New		☐

Cylinders

Num	Size	Type	Mfg Date	Hydro	6 Year	S/N	Bar Code	Timestamp
1	3 Gal	Extinguishing Agent	2012	2012		20120908451	AQ0008377	4/23/2014 9:04:04 AM

Replacement Parts

Qty	Description	Part No.	Replaced
4	Fuse Links 360°F Globe ML	360ML-11	10/2014
3	Fuse Links 360°F K Link	360K-11	11/10/2015
8	Ansul Nozzle Cap	AS77695	10/2014
1	Fuse Links 450°F K Link	450K-11	11/10/2015

Appliances (Left to Right)

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems**Service History**

Order # 11399

JOB LOCATION

Freshlys
34500 Euclid Avenue
216-773-0928
Willoughby OH 44094

P1: (216)773-0928
P2:
F:

CLIENT

Freshlys
34500 Euclid Avenue
Willoughby OH 44094

Num	Description	Size	Nozzle(s)
1	Range - 1 Burner		
2	Fryer - Gas		
3	Grill - 36"		
4	Gyro		
5	Gyro		
6	Gyro		

INSPECTION**I. Fire Suppression Systems**

	OK	FAIL	NA
1. Hood and appliances properly protected?	☒	☐	☐
2. Was nozzle/appliance alignment correct upon arrival?	☒	☐	☐
If not was the alignment corrected during inspection?			
3. System cylinder gauge in operable range?	☐	☐	☒
4. Cylinder weight or liquid level OK?	☒	☐	☐
5. Fusible links replaced?	☒	☐	☐
6. Actuation cartridge weight or gauge in operable range?	☒	☐	☐
/* Stamped weight 42 1/2 oz, Actual weight 42 1/2 oz */			
7. Complete fuel shut-down operational?	☒	☐	☐
8. Remote pull station accessible and operational?	☒	☐	☐
9. All components clean and free of grease?	☒	☐	☐
10. Nozzle caps cleaned or replaced?	☒	☐	☐
11. System meets manufacturer installation instructions?	☒	☐	☐
12. System conduit and piping securely mounted?	☒	☐	☐
13. Does system meet UL 300 standard?	☒	☐	☐
14. Employees trained in the proper operation of the system?	☒	☐	☐
15. Audible and/or visual alarms functional?	☒	☐	☐
16. System reset and placed back in service?	☒	☐	☐
17. System connected to central station?	☐	☐	☒
18. Class K extinguisher present and functional?	☒	☐	☐
19. Do hood and duct comply with NFPA #96?	☒	☐	☐
20. Company State of Ohio Certification # 53-28-1034	☒	☐	☐
21. State of Ohio Certification Jon LeRoy 54-18-1535	☒	☐	☐
22. State of Ohio Certification Randolph N Kaser 54-18-0381	☐	☐	☒
23. Complete Hydrostatic Pressure Test Current	☒	☐	☐

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS

Acquire Fire Protection, Inc.

17012 Kinsman Road
Middlefield, Ohio 44062

Fire Suppression Systems**Service History**

Order # 11399

JOB LOCATION

Freshlys
34500 Euclid Avenue
216-773-0928
Willoughby OH 44094

P1: (216)773-0928

P2:

F:

CLIENT

Freshlys
34500 Euclid Avenue
Willoughby OH 44094

INSPECTION**I. Fire Suppression Systems**

OK FAIL NA

24. Complete 6 Year Maintenance Current

☐ ☐ ☒

I state that the information on this form is correct at the time and place of my inspection. And that all equipment tested at this time was left in operational condition upon completion of this inspection except as noted above.

Acquire Fire Protection, Inc. / Fire Loss Control, Inc.

Technician

X 

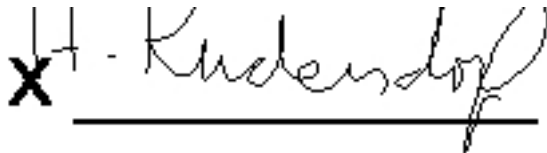
Jonathan LeRoy

11/11/2015

Customer Signature

X _____

Fire Inspector

X 

11/10/2015

*** End Report: 1 ***

ALL WORK DONE IN ACCORDANCE WITH N.F.P.A. STANDARDS